

# Construction & Home Improvement Markets

## **Product Information Sheet**

Issue:September 2022 Supersedes: Dec 2021

## **Command™ Picture Hanging Strips**



### **General Description**

Command™ Picture Hanging Strips combine a unique interlocking fastener with a Command® Adhesive Strip to provide strong holding power and clean removability with detachability. The interlocking fasteners "snap" together tightly but can be pulled apart easily and reattached repeatedly.

Command® Adhesive Strips are high performance pressure sensitive adhesive strips with a unique stretchable foam backing which allows for clean, damage-free removal from most surfaces. The adhesive strips adhere to a wide variety of surfaces, including paints that are difficult to stick to, and are quick and easy to install without tools.

The strips come in multiple sizes and are available with a white or black foam backing. The strips are ideal for mounting frames, pictures, and other flat items to most wall surfaces.

## **Strip Construction**

Backing	Polyethylene Foam	
Adhesive Type	Silicone	
Interlocking Fastener	Polypropylene Stems	
Average Thickness (Foam Only)	1.07 mm	
Average Thickness (Foam and Fastener)	2.54 mm	
Color	White or Black	
Release Liner	White paper with green print (0.076mm)	
Approximate Foam Density	96 kg/m³	

## Typical Physical Properties and Performance Characteristics


Note: The following technical information and data should be considered representative or typical only and should not be used for specification purposes.

Static Shear Strength (ASTM D-3654)	1000 g at 22°C	
Temperature Resistance	-10°C to 50°C	
U.V. Resistance	Not recommended for direct exposure to U.V. light	
Storage Conditions	Store under normal conditions 16° to 27°C and 40 to 60%	
Storage Conditions	relative humidity in the original packaging	

## **Available Sizes**

	Strip Width & Length	Tab Length	Adhesive (Wall Side) and Fastener (Interlocking Side) Width & Length	Ref
Extra Large (XL)	2.22 cm x 11.11 cm	2.22 cm	2.22 cm x 8.89 cm	17217
Large	1.90 cm x 9.27 cm	1.90 cm	1.90 cm x 7.36 cm	17206
Medium	1.90 cm x 6.98 cm	1.90 cm	1.90 cm x 5.08 cm	17201 - 17204
Small	1.58 cm x 5.39 cm	1.90 cm	1.58 cm x 3.49 cm	17202 - 17205
Mini	1.27 cm x 3.97 cm	1.27cm	1.27 cm x 2.38 cm	
Narrow	1.27 cm x 9.27 cm	1.90 cm	1.27 cm x 7.36 cm	17207



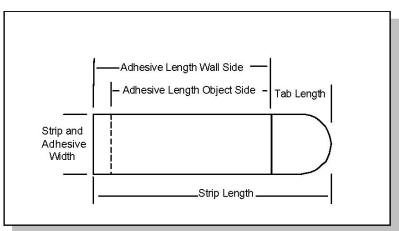


Feature	Advantage	Benefit
Pressure-Sensitive Adhesive Strips	High adhesion	Excellent holding power
	Broad adhesion	Adheres to a wide variety of surfaces
	Quick and easy to install	No tools required
Stretch-Release Technology	Easy removal	Removes cleanly from most surfaces without damage
Foam Backing	Conformable	Adheres to both smooth and semi- rough surfaces
Silicone Adhesive	Water Resistance	Allows for use in wet or humid environments
	Temperature Resistance	Allows for use in more extreme cold and hot temperatures
Interlocking Fastener	Secure fastener engagement	No hardware needed; items are held securely and evenly to the surface
		Fasteners "snap" together, providing indication of secure engagement of strips
	Detachable	Mounted items can be repositioned
		Designed to hold frames up to 24 x 36 inches

### **Application and removal for Picture Hanging Strips:**

## PREP PREPARADO



Wait 7 days after painting before use. Después de pintar espere 7 días antes de usar.



Remove hanging hardware. Do not apply to paper or fabric surfaces on frame.

Retire el colgador metálico. No aplique las tiras sobre papelo superficies suaves en el marco.



Wipe wall with rubbing alcohol. Do not use household cleaners or water.

Limpie la pared con alcohol isopropílico. No utilice limpiadores de uso doméstico o agua:

#### APPLY APLIQUE



Separate strips. Click strips together. Separe las tiras. Presione hasta que haganclic.





HALF Way

DOWN

ENLA

MITAD DEL CUADRO

Remove one side of liners. Stick on frame as shown.

Press firmty.

Retire un lado de los protectors. Pegue en el marco como se muestra. Presione con firmeza.



Remove remaining liners. Press frame firmly to wall. Complete steps 4-6.
Retire los protectores restantes. Presione

Retire los protectores restantes. Presione el marco firmemente a la pared. Completa los pasos 4-6.

#### Critical steps to ensure hold. Pasos necesarios para asegurar que peque.




Temporarily remove frame from wall to reinforce strips. Peel frame as shown.
Retire temporalmente el marco de la pared para asegurarlo. Retire el marco como se indica.



Press each strip on wall for 30 sec. Presione firmemente cada tira en la pared por 30 segundos.



Wait 1 hour for adhesive to build. Espere 1 hora para que el adhesivo pegue correctamente.



Align strips. Press frame until each pair of strips clicks.
Alinee las tiras. Presione al marco hasta que cada par de tiras haga clic.

#### REMOVE

#### RETIRE



Grab bottom corners and peel frame from wall. Do not pull straight off. Agarre las esquinas inferiores del marco y jale de la pared. No tire hacia afuera.



Never pull away from wall. Stretch strips slowly against the wall at least 15 Inches to release. Nunca jale horizontalmente la tira. Estire la tira lentamente contra la pared por lo menos 38 cm para soltar.



#### Notes:

- Failure to follow instructions carefully may result in damage
- Do not use with wallpaper
- May not adhere well to vinyl surfaces
- DO NOT use for antiques, heirlooms, or other valuable or irreplaceable items
- DO NOT hang objects over beds
- Apply to surfaces above 15° F (-10° C)
- Adhesive could soften and lose adhesion above 120° F (50°C)
- Not for use in direct sunlight
- Will not adhere to dirty, dusty, or oily surfaces
- Wait at least 7 days to apply to freshly painted surfaces
- Not recommended for use on bare wood or porous, unpainted surfaces
- Holding capacity is reduced if adequate pressure is not applied over 30 seconds or if the load is applied less than one hour after the adhesive has been applied

**3M** Construction and Home Improvement Markets Division Please write your local 3M adress

IMPORTANT NOTICE: All statements, technical information and recommendations herein are based on tests and studies 3M believes to be reliable. 3M does not warrant or guarantee the accuracy or completeness of this information. Because there are many factors that can affect the use and performance of this product, some of which are uniquely within the user's knowledge and control, it is essential that the user evaluates this product to determine whether it is fit for a particular purpose, is suitable for the user's method of application, and meets the user's performance specifications and expectations. Before any use, it is always recommended to read and follow the instructions for use and to conduct tests to validate the adequacy of the product with regard to the envisaged use. Any action or use of the product made in breach of these indications is at the risks of the user and consequently 3M cannot be held responsible for whatever negative consequences may arise out of or in connection with any breach of the given instructions and indications. Compliance with 3M instructions for use and other recommendations does not exempt the user from respecting other local applicable rules (safety rules, standards and procedures) governing the use of the concerned product in specific contexts and/or through specific means or tools.

<u>Limitation of Liability:</u> 3M's only obligation shall be to replace such quantity of this 3M product proved to be defective or to return the purchase price. Statements or recommendations not contained herein shall not have any force or effect unless included in an agreement signed by a 3M officer.

3M reserves the right to amend the whole or part of this document at any time, without notice.

3M, Command, and the Plaid Design are trademarks of 3M Company.  $\ @$  3M 2020 P 4/4